

QUILEUTE TRIBAL SCHOOL



Asbestos
Location Details
November 16, 2016



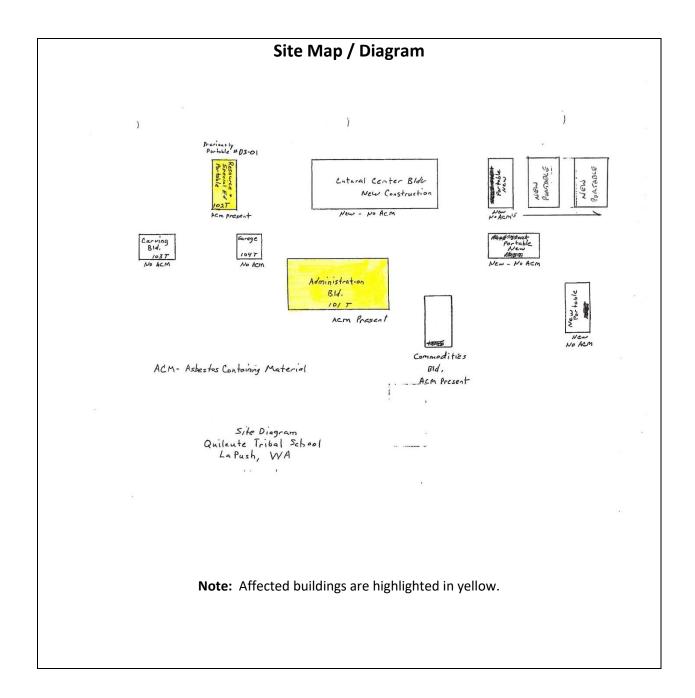

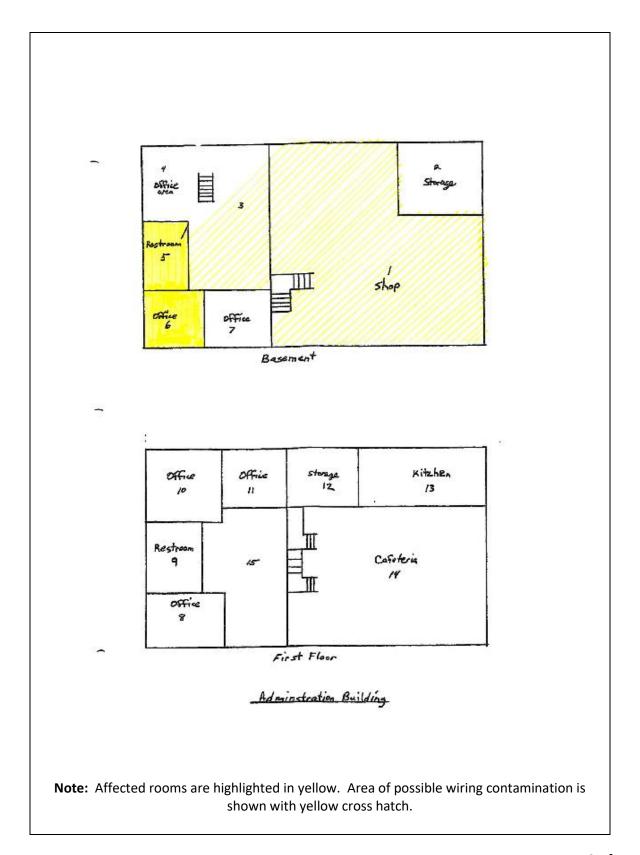

Old Administration Building (101T) - looking West



Old Administration Building (101T) - looking
East
Testing confirmed portions of building contain asbestos.



Old Administration Building (101T) – SW

Corner Basement Office 6

[9" floor tiles and mastic of 3% Chrysotile]



Old Administration Building (101T) – SE

Corner Basement Office 6

[9" floor tiles and mastic of 3% Chrysotile]



Old Administration Building (101T) – Basement Office 6

View is looking SW in through the doorway into the phone equipment room.



Old Administration Building (101T) – Basement
Office 6

View is looking at floor in through the doorway into the phone equipment room.

[9" floor tiles and mastic of 3% Chrysotile]



Old Administration Building (101T) – Old Basement Restroom 5

[Area confirmed to contain asbestos in WAT 07-29-2016 sample.]



Old Administration Building (101T) – Restroom 5 Doorway Layer Detail

[9" gray floor tiles and mastic of 2% and 4% Chrysotile, respectively. Yellow vinyl is non-asbestos containing per WAT 07-29-2016 sample.]



Old Administration Building (101T) – Outside Restroom 5

View is looking up at the area where WAT Sample #4 was taken – a non-asbestos wire sample.



Old Administration Building (101T) – Shop 1 View is looking at assorted ceiling wiring.



Old Administration Building (101T) – Sample of Old Basement Office Wiring on West End [Area of possible asbestos containing material]



Old Administration Building (101T) – Sample of Old Basement Office Wiring [Area of possible asbestos containing material]



Old Administration Building (101T) – Sample of Old Basement Office Wiring on West End [Area of possible asbestos containing material]




Old Administration Building (101T) – Sample of Old Basement Office Wiring on East End [Area of possible asbestos containing material]



Old Administration Building (101T) – Sample of Old Basement Office Wiring on West End
[Area of possible asbestos containing material. WAT 07-29-2016 sample indicated non-asbestos material.]



Old Administration Building (101T) – Sample of Old Basement Office Wiring on West End

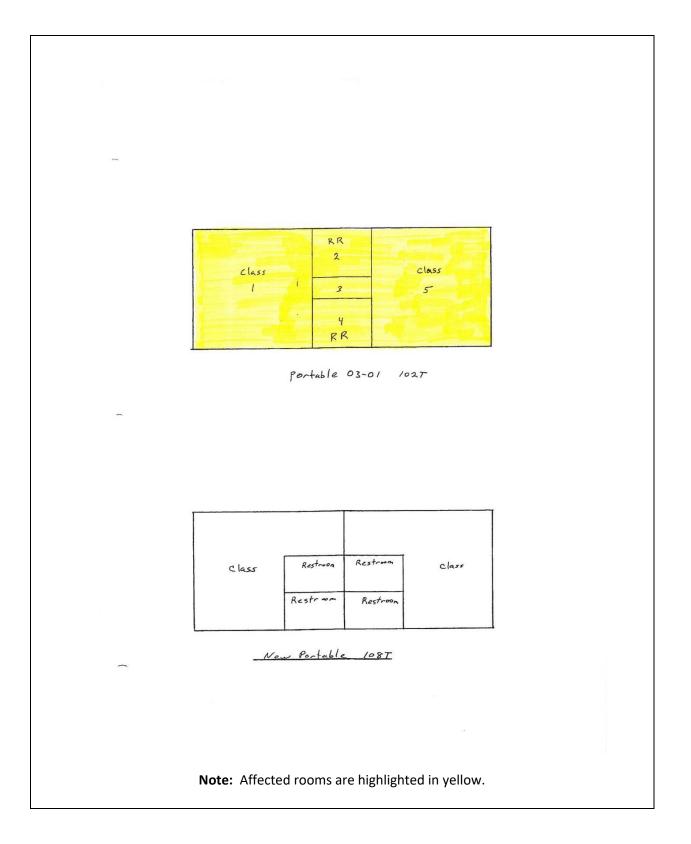



Culture Building (102T) – Picture Shows the SW Corner of the Building



Culture Building (102T) – Picture Shows the NW Corner of the Building



Culture Building (102T) – Classroom 5
Original floor covering has been hidden by
wall-to-wall carpet.


[Sheet vinyl flooring with 30% Chrysotile]



Culture Building (102T) – NE Corner of Classroom 5

Original floor covering has been hidden by wall-to-wall carpet.

[Sheet vinyl flooring with 30% Chrysotile]

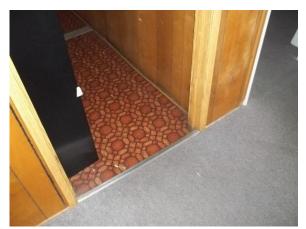

Culture Building (102T) – Hallway to Classroom 5

Original floor covering has been hidden by wall-to-wall carpet in classroom and hallway is original material.

[Sheet vinyl flooring with 30% Chrysotile]



Culture Building (102T) – NW Corner of Classroom 1

This is original floor covering.
[Sheet vinyl flooring with 30% Chrysotile]



Culture Building (102T) – SW Corner of Classroom 1

This is original floor covering.
[Sheet vinyl flooring with 30% Chrysotile]



Culture Building (102T) – Exit Doorway from Classroom 1

This is the original floor covering covered by a throw rug.

[Sheet vinyl flooring with 30% Chrysotile]




Culture Building (102T) – SE Corner Doorway

Detail in Classroom 1

Original floor covering with trim removed and no apparent damage.

[Sheet vinyl flooring with 30% Chrysotile]

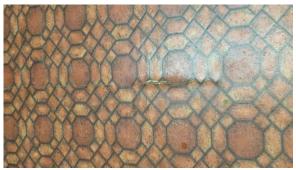

Culture Building (102T) – Floor Covering Crack Detail in Classroom 1

This is original floor covering.
[Sheet vinyl flooring with 30% Chrysotile]



Culture Building (102T) – Floor Covering General Area of Crack in Classroom 1

This is original floor covering.

[Sheet vinyl flooring with 30% Chrysotile]



Culture Building (102T) – Exit Doorway from Classroom 1 with Floor Mat Covering Damaged Floor

[Sheet vinyl flooring with 30% Chrysotile]